

LANCOM Release Notes

LANtools 10.50 RU5

Copyright © 2002-2022 LANCOM Systems GmbH, Wuerselen (Germany)

LANCOM Systems GmbH
Adenauerstrasse 20 / B2
52146 Wuerselen
Germany

Internet: <http://www.lancom-systems.com>

January 12th, 2022, CBuersch

Table of Contents

1. Preface	2
2. New features, improvements, and history	3
LANconfig 10.50.0039 RU5	3
LANconfig 10.50.0037 RU4 / LANmonitor 10.50.0019 RU3	4
LANconfig 10.50.0032 RU3 / LANmonitor 10.50.0016 RU2	5
LANconfig 10.50.0029 RU2 / LANmonitor 10.50.0014 RU1	6
LANconfig 10.50.0023 RU1	7
LANconfig 10.50.0019 Rel / LANmonitor 10.50.0012 Rel	7
LANconfig 10.50.0013 RC3 / LANmonitor 10.50.0011 RC3	8
LANconfig 10.50.0010 RC2 / LANmonitor 10.50.0010 RC2	8
LANconfig 10.50.0008 RC1 / LANmonitor 10.50.0006 RC1	8
3. Important advice	9
Disclaimer	9

1. Preface

The LANtools are a comprehensive set of free management & monitoring tools for a detailed configuration and monitoring of LANCOM devices.

This document describes the innovations within LANtools version 10.50 RU5, as well as the improvements since the previous version.

Note

LANCOM LANtools support Microsoft Windows 7, Windows 8, Windows 10, Windows 11, Windows 2008 Server, Windows Small Business Server 2011, Windows Server 2012, Windows Server 2012 R2, Windows Server 2016, and Windows Server 2019 (all 32- and 64-bit versions).

For Windows Vista and Windows 2008 Server you will find user data under \Users\USER\AppData\Roaming\LANCOM\ and the application files under \ProgramData\LANCOM\.

When upgrading to LANtools 8.50 or newer, all existing user- and application data is moved to the corresponding folders.

2. New features, improvements, and history

LANconfig 10.50.0039 RU5

Bugfixes / improvements

LANconfig

- › When creating a fifth IPoE connection on the LANCOM 1906VA-4G with the setup wizard, an error message appeared stating that no additional DSL interface was available.
- › With the LANCOM routers of the 1793 series the configuration option for the line code (ISDN/POTS) was missing in the LANconfig menu 'Interfaces / WAN / Interface settings / VDSL'.
- › In the IPv6 routing table, the 'Router' field was missing the 'Load balancer' source selection.

LANconfig 10.50.0037 RU4 / LANmonitor 10.50.0019 RU3

Bugfixes / improvements

LANconfig

- When running the setup wizard 'Voice-over-IP / All-IP / Connection to a Telekom CompanyFlex SIP trunk' on a LANCOM 1926VAG, no ISDN users were created, although they were configured in the wizard.
- A LANCOM L-321agn (R2) could no longer be managed via LANconfig.
- If the setup wizard was used to configure a Public Spot without first running the setup wizard for basic Wi-Fi configuration, or if the 'Configure a new Wi-Fi' option was enabled when setting up the Public Spot, the wizard overwrote existing channel settings of the Wi-Fi module with channel 11.
- The sort order of the 'DNS forwarding' list differed in LANconfig from the sort order of the table in WEBconfig. The sorting order has now been aligned with that in WEBconfig.
- Some triggers for LANconfig program crashes have been fixed.
- The character 'ALT+34' could not be used when assigning a WPA-PSK.
- In the menu 'Certificates / SCEP client functionality / Certificate table' the usage type 'OCSP' was not present.
- Via LANconfig, a maximum of 1,000 access points could be entered in the access point table of a WLC.

LANmonitor

- In LANmonitor, instead of the required PoE power of a LANCOM device, a global value was always displayed, which did not match the actual required PoE power of the device.
- In the path 'Software update' a numerical value was displayed for the 'Result of last check'.

LANconfig 10.50.0032 RU3 / LANmonitor 10.50.0016 RU2

Bugfixes / improvements

LANconfig

- The “Voice Call Manager” menu was displayed in the configuration dialog for vRouter, although it is not available for vRouter.
- The table index of the action table was also recalculated if the action table dialog in LCOS was exited with the “Cancel” button. Now the index is only recalculated if a change is made and the configuration dialog is exited with the “OK” button.
- In the dialog for entering BGP neighbors, special characters (e.g. % characters) and link-local IPv6 addresses with scope can now be entered in the “IP address” field.
- If the number block 10-19 was specified in the setup wizard for CompanyFlex extension number ranges, the entry for “Remove root number (internal call)” in the call routes was only created for extensions *10 to *18.
- On LANCOM devices where many software options were activated, it could happen that the configuration dialog could not be opened because the page limit was exceeded.

LANconfig 10.50.0029 RU2 / LANmonitor 10.50.0014 RU1

New Features

- New wizard for migrating Telekom SIP trunk connections to Company Flex connections
- The dialog for configuring DNS forwarding in the VPN wizard 'Connect two local networks (VPN)' has been extended.

Bugfixes / improvements

LANconfig

- In the configuration of LANCOM Central Site devices (e.g. LANCOM ISG-1000) the CWMP/TR-069 function could be configured although the devices do not support this.
- In the LANCOM 1781x series devices, the VoIP Setup Wizard for Company Flex connections incorrectly composed the SIP ID when configuring individual call numbers.
- In the configuration of a LANCOM 1900EF it was not possible to configure channel bundling in the menu 'Communication / General / Communication layer'.
- An IPv4 firewall rule created in LANconfig 10.4x or lower, in which a Layer 7 application definition was specified as the connection destination, could not be opened under LANconfig 10.50.

LANmonitor

- In LANmonitor the detailed information of created VoIP users was not displayed.

LANconfig 10.50.0023 RU1

New Features

- › Support for LCOS LX 5.34

Bugfixes / improvements

- › In the configuration interface of a LANCOM 1926VAG the menu items "Communication / RADIUS and Communication / Call Management" and their submenus were missing.
- › In the path "Setup / IP Router / Firewall / Rules", only a maximum of 16 characters could be used for the name of a rule, which meant that the rule could not be applied if the number of characters for the name was exceeded. The number of characters for the rule name has now been changed to a maximum of 32 characters.
- › When creating ICMP measurement profiles for Dynamic Path Selection, a maximum value of 30 milliseconds could be specified as the measurement interval, but this was not sufficient for some measurements. The maximum value has now been increased to 1000 milliseconds.

LANconfig 10.50.0019 Rel / LANmonitor 10.50.0012 Rel

New Features

LANconfig

- › The configuration for DNS has been moved from IPv4 to a separate section.

LANmonitor

- › WLANmonitor now supports access points with LCOS LX from version 5.32 RU1.

Bugfixes / improvements

LANconfig

- › If a parameter was changed in a configuration file exported from an LCOS LX device, a subsequent upload to the same or identical LCOS LX device failed.

LANconfig 10.50.0013 RC3 / LANmonitor 10.50.0011 RC3

Bugfixes / improvements

LANconfig

- > In the menu 'WLAN / 802.11u / Hotspot 2.0 Profile' the link to the table 'OSU providers' was missing. As a result, multiple selection of providers via selection dialog was not possible.
- > In the Dynamic Path Selection (DPS) policies in the 'IP Router / Routing / SD-WAN Dynamic Path Selection (DPS) / Policies' menu, HTTP measurement profiles could not be selected.
- > No maximum channel bandwidth of 160MHz could be selected in the access point profiles of a LANCOM WLC.

LANconfig 10.50.0010 RC2 / LANmonitor 10.50.0010 RC2

Bugfixes / improvements

LANconfig / LANmonitor

- > In the menu 'Wireless LAN / 802.1X / RADIUS servers' the selection dialog for specifying the protocol used was missing in the profile entry for a RADIUS server.
- > In LANmonitor, only the status code "144" was displayed when a volume budget value of 80% was reached.

LANconfig 10.50.0008 RC1 / LANmonitor 10.50.0006 RC1

New features

LANconfig / LANmonitor

- > Support for LCOS 10.50

3. Important advice

Disclaimer

LANCOM Systems GmbH does not take any guarantee and liability for software not developed, manufactured or distributed by LANCOM Systems GmbH, especially not for shareware and other extraneous software.