

LANCOM Release Notes



10.50 Rel

Copyright © 2002-2021 LANCOM Systems GmbH, Wuerselen (Germany)

LANCOM Systems GmbH
Adenauerstrasse 20 / B2
52146 Wuerselen
Germany

Internet: <http://www.lancom-systems.com>

July 14th, 2021, CBuersch

Table of Contents

1. Preface	2
2. Device-specific compatibility to LCOS 10.50	2
3. Advices regarding LCOS 10.50	3
Information on default settings	3
4. Feature overview LCOS 10.50	4
4.1 Feature highlights 10.50	4
Performance upgrade for the LANCOM ISG-8000	4
Fast failover for maximum operational reliability	4
4.2 Further features 10.50	5
Extension of IPv6 functionality	5
Platform expansion for the LANCOM vRouter	5
5. History LCOS 10.50	6
LCOS improvements 10.50.0145 Rel	6
LCOS improvements 10.50.0129 RC3	8
LCOS improvements 10.50.0115 RC2	9
LCOS improvements 10.50.0091 RC1	9
6. General advice	11
Disclaimer	11
Backing up the current configuration	11
Using converter firmwares to free up memory	11

1. Preface

The LANCOM family of operating systems—LCOS, LCOS SX, LCOS LX, and LCOS FX—forms the trusted basis for the entire LANCOM range of products. Within the scope of the hardware specified by the products, the latest firmware version is available for all LANCOM products and is offered by LANCOM Systems for download free of charge.

This document describes the innovations within LCOS software release 10.50 Rel, as well as the improvements since the previous version.

Before upgrading the firmware, please pay close attention to chapter 6 “General advice” of this document.

Latest support notes and known issues regarding the current LCOS version can be found in the support area of our website <https://www.lancom-systems.com/service-support/instant-help/common-support-tips/>

2. Device-specific compatibility to LCOS 10.50

LANCOM products regularly receive major firmware releases throughout their lifetime which provide new features and bugfixes.

LCOS release updates including bugfixes and general improvements are available on a regular basis for devices which do not support the latest LCOS version. You can find an overview of the latest supported LCOS version for your device under <https://www.lancom-systems.com/products/firmware/lifecycle-management/product-tables/>

Support for the following devices is no longer available as from LCOS 10.50:

- > LANCOM 1631E
- > LANCOM 1781-4G
- > LANCOM 1781A
- > LANCOM 1781AW
- > LANCOM 1781VA-4G
- > LANCOM 730-4G
- > LANCOM 7100+
- > LANCOM 9100+
- > LANCOM IAP-4G
- > LANCOM L-151
- > LANCOM L-151E
- > LANCOM L-320 R2
- > LANCOM L-330
- > LANCOM WLC-4025+
- > LANCOM WLC-4100

3. Advices regarding LCOS 10.50

Information on default settings

Devices delivered with LCOS 10.00 or higher automatically connect to the LANCOM Management Cloud (LMC). This functionality provides zero-touch installation for new devices. In case you do not want to use the LMC, this feature can be disabled while running the default setup wizard for the initial configuration, or at any time from within LANconfig under Management > LMC. You can manually re-enable the usage of the LMC whenever you want.

4. Feature overview LCOS 10.50

4.1 Feature highlights 10.50

Performance upgrade for the LANCOM ISG-8000

In large SD-WAN or site networking scenarios with a high number of IPsec VPN channels and high data volumes, the use of the LANCOM ISG-8000 central site VPN gateway is now even more efficient. By distributing the data load across multiple cores (multicore), the total performance of IPsec VPN connections is increased to 10 Gbps. Significantly more data can thus be exchanged in less time when using multiple VPN channels.

Fast failover for maximum operational reliability

Fast failover times are essential in infrastructures that require maximum operational reliability. By using Dynamic Path Selection (DPS) or BGP, switching from one IPsec-VPN channel to another takes less than a second now. Thus, in an active-active mode, the failure of a connection does not lead to any noticeable downtime, e.g. in business-critical processes such as payment transactions with EC cash terminals.

4.2 Further features 10.50

Extension of IPv6 functionality

Benefit from even more future-proofing of your IPv6 site networking now: As of LCOS 10.50 RC1, functions such as 464XLAT with IPv6-only in cellular radio, NAT with IPv6 (NPTv6), load balancing with IPv6, and IPv6 polling are supported.

Platform expansion for the LANCOM vRouter

For even more versatile use, the LANCOM vRouter now also supports KVM (Kernel-based Virtual Machine) in addition to the hypervisor platforms Hyper-V, ESXi, and Azure.

You can find further features within the individual builds sections in chapter 5 “History LCOS 10.50”.

5. History LCOS 10.50

LCOS improvements 10.50.0145 Rel

New features

- Support for RADIUS Dynamic Peer Discovery according to RFC 7585

Bug fixes / improvements

General

- When creating a RADIUS user via WEBconfig, the user profile could not be saved if no passphrase was entered there.
- With the console command 'passwd -n' a password change can be performed without query. The change was not applied to SNMP access, so SNMP access was possible with the old password.
- When using certificates with 'Elliptic Curve Algorithm' for RADSEC, TLS negotiation could not be completed successfully.
Furthermore, the 'Private Key' of a certificate with 'Elliptic Curve Algorithm' could not be uploaded to the RADSEC slot. The import process was aborted with the message "FAILURE".

VPN

- If the router tried to send a packet over the VPN connection during a VPN setup in the time window between IKE negotiation and the change to the 'Up' state, all packets were dropped.
- After taking down and then re-establishing a VPN connection (both IKEv1 and IKEv2) with IPv6 on a vRouter or LANCOM ISG-8000, the VPN rules (SA) were not established correctly. As a result, communication over the VPN connection was no longer possible.

VoIP

- It could happen that phone calls were not transmitted via the SIP-ALG because the external port was declared as invalid by the router. The packets were then rejected with the error message "ICMP Destination unreachable (Port unreachable)".
Furthermore, the bandwidth reservation in SIP-ALG did not work anymore.
- In a scenario with a Swyx Mediabridge a REFER with the actual destination of the call is sent in the 'Refer-To' header after call setup. Then the router sends an INVITE to this 'Refer-To' destination via the Swyx PBX. In case of an error the Swyx PBX did not answer with a "200 OK" but with the error message "500 Server Internal Error". In this case the router tried to send the INVITE on another line. But since the replace information from the REFER was still used for this, the router sent the INVITE again via the gateway line to the Swyx PBX.
An INVITE is no longer sent on a gateway line after the error message "500 Server Internal Error" has been received on this line. Furthermore the router waits for a BYE from the Swyx PBX and then terminates the call setup. If no BYE is received from the Swyx PBX, the router sends the BYE and terminates the call setup.

- In individual cases, it can happen that an UPDATE is sent by the caller instead of the called party for an incoming call during the early media phase. In such a case, the UPDATE was sent by the router back to the SIP line instead of to the local subscriber. This resulted in a one-way voice transmission.
- In a scenario with a parent SIP PBX, if different codecs are used in the sessions between the router and the SIP client and the router and the SIP PBX for an outgoing call, the codec must be renegotiated with the SIP client in a re-INVITE so that the codec matches. If the SIP PBX sent a Re-INVITE to forward the call to the router at that moment, it was sent from the router to the SIP client even though the first Re-INVITE was not confirmed yet. This resulted in missing voice transmission in connection with noise at the calling subscriber.

The transmission of the second Re-INVITE of the SIP TC system is now transmitted only when the first negotiation is completed.

LCOS improvements 10.50.0129 RC3

New features

General

- New DSL line code for LANCOM 1926 series devices
- On the DSL routers of the 19xx and 179x series, it is possible to switch between the current and an alternative DSL line code.
- Support of a DNS filter for detection and filtering of unwanted DNS data tunnels at the client side
- Support for IPv6 prefix discovery with 464XLAT according to RFC 7050
- The WLC disables DNS servers and DNS forwarders on managed APs.
- New VPN analysis command 'ikectl' on the command line
- Support for automatic path MTU detection with IPSec.

Bug fixes / improvements

General

- In WEBconfig, only the user data of one selected Public Spot user could be printed. If multiple user records were selected for printing, the printing process ended in an endless loading loop.
- An access via LL2M to a device with hashed password failed and was acknowledged with the error message "user unknown on remote system".
- Creating a Wireshark trace via LCOSCap on a device with a hashed password failed and was acknowledged with the error message "cannot retrieve PSK".

LCOS improvements 10.50.0115 RC2

New features

Wi-Fi

- › Support for Fast Roaming over-the-DS

Bug fixes / improvements

General

- › After an update to LCOS 10.50 RC1 it could happen that after a configuration synchronization with the LANCOM Management Cloud (LMC) a firewall rule containing a DNS destination could no longer be edited with LANconfig.
- › It could happen in individual cases that sessions were not terminated properly (e.g. when using IPsec-over-HTTPS) and the reserved memory was not released again. This caused further packets to be dropped and communication was only possible to a very limited extent.
- › When using the LOCALNET station object in firewall rules, routes learned via RIP and BGP were assigned to LOCALNET. This could lead to a high load on the router's CPU due to a large number of filter rules. Only networks with the status 'Connected LAN' are now assigned to the LOCALNET station object.

LCOS improvements 10.50.0091 RC1

New features

- › Performance optimization due to multicore support for LANCOM ISG-8000 with IPsec VPN
- › Support for Bidirectional Forwarding Detection (BFD) with BGP
- › (Sub Second) Session Switchover for Dynamic Path Selection (DPS)
- › DPS: ICMP measurement intervals now support intervals with a time resolution in milliseconds
- › DPS: In addition to ICMP, HTTP(S) is also supported as a measurement method
- › Support of the CLAT side of 464XLAT for IPv6-only in mobile communications
- › NPTv6 (prefix NAT) support for IPv6
- › The load balancer now supports IPv6
- › IPv6 line polling support
- › In the IPv6 firewall, MAC addresses can be configured as a station object (source).
- › In the IPv6 firewall, a delegated provider prefix can be configured as a station object to share a dynamic prefix in a router cascade.
- › In applications where DNS names can be configured, the preferred address family (IPv4 or IPv6) can be specified.
- › Dynamic Path Selection (DPS) now supports IPv6.
- › Support for Curve448 in SSH
- › Public Spot now supports IPv6.

- Public Spot: The MAC address format is now configurable.
- Support for RADIUS attributes according to RFC 5580
- The DHCP client now displays the lease time in the status menu.
- The Rx / Tx bandwidth limitation is now also evaluated for 802.1x RADIUS authentication.
- The Layer7 application detection and DNS names in the firewall can now be configured in a common table.
- Support for session cookie and anti-CSRF token in WEBconfig
- Plain text passwords of the main device password are disabled after a device reset.
- The IKEv2 lifetimes are adapted to the current BSI recommendations after a device reset.
- SHA-1 is no longer included in the IKEv2 default proposal after a device reset.
- The delegated IPv6 provider prefix can be transmitted to the VPN peer via IKEv2 routing.
- Support for H.323 in the IPv4 firewall is removed.
- The vRouter now supports KVM as a hypervisor platform.

Bug fixes / improvements

VoIP

- If a VoIP client sent the parameter 'rtcp-rsize' with an outgoing call, the LANCOM router recognized this parameter as 'Invalid' and rejected the 'Invite' with the message "406 SDP - not acceptable". As a result, the outgoing call did not go through.
- With an incoming ISDN call it could happen that the external caller could not hear the called party (one-way voice transmission) because the 'Media Attribute (a): nortpproxy:yes' prevented the transmission of RTP data.
- When using SIP-ALG, it could happen that the port for RTP communication became invalid and an incoming RTP packet was rejected with the message "ICMP Destination unreachable (Port unreachable)". This resulted in a one-way voice transmission on the part of the called subscriber during an outgoing telephone call.
- The Voice Call Manager supports multiple streams with different codecs. However, these must be initialized during the call setup.
If a call was initially established with one stream (e.g. G.711) and a second stream was added in the re-INVITE (e.g. T.38), the Voice Call Manager could not process the second stream. As a result, data packets of the second stream were not transmitted anymore.

6. General advice

Disclaimer

LANCOM Systems GmbH does not take any guarantee and liability for software not developed, manufactured or distributed by LANCOM Systems GmbH, especially not for shareware and other extraneous software.

Backing up the current configuration

Before upgrading your LANCOM devices to a new LCOS version it is essential to backup the configuration data!

Due to extensive features it is **not possible to downgrade** to a previous firmware without using the backup configuration.

If you want to upgrade devices which are only accessible via router connections or Wi-Fi bridges, please keep in mind to upgrade the remote device first and the local device afterwards. Please see the [LCOS reference manual](#) for instructions on how to upgrade the firmware.

We strongly recommend updating productive systems in client environment only after internal tests.

Despite intense internal and external quality assurance procedures possibly not all risks can be eliminated by LANCOM Systems.

Using converter firmwares to free up memory

Due to numerous new functions within the LCOS firmware it may not be possible in some circumstances for older devices to keep two fully-featured firmware versions at the same time in the device. To gain more free memory, a smaller firmware with less functionality has to be uploaded to the device first. As a result, significantly more memory will be available for a second firmware.

This installation has to be done only once by using a "converter firmware".

After having installed the converter firmware, the firmsafe function of the LANCOM device is only available on a limited scale. The update to a new firmware is furthermore possible without any problems.

However, after a failed update the LANCOM device works with the converter firmware which only allows local device access. Any advanced functionality, particularly the remote administration, is not available as long as the converter firmware is active.