

# Release Notes

# LCOS 10.72 RU14

## Table of contents

03	<b>1. Preface</b>
03	<b>2. The release tag in the software name</b>
04	<b>3. Device-specific compatibility to LCOS 10.72</b>
04	<b>4. Advices regarding LCOS 10.72</b>
04	Information on default settings
04	Omission of VPN rules in the IPv4 firewall
05	<b>5. Feature overview LCOS 10.72</b>
05	<b>5.1 Feature highlights 10.72</b>
05	Advanced Mesh VPN
05	<b>5.2 Further features 10.72</b>
05	Protection of minors according to official regulations
05	Two-factor authentication – double security for your VPN
06	<b>6. History LCOS 10.72</b>
06	LCOS improvements 10.72.0982 RU14
07	LCOS improvements 10.72.0979 RU13
08	LCOS improvements 10.72.0974 RU12
09	LCOS improvements 10.72.0890 RU11
12	LCOS improvements 10.72.0771 SU10
13	LCOS improvements 10.72.0770 RU9
15	LCOS improvements 10.72.0696 RU8



16	LCOS improvements 10.72.0593 RU7
18	LCOS improvements 10.72.0484 RU6
20	LCOS improvements 10.72.0385 RU5
22	LCOS improvements 10.72.0291 RU4
24	LCOS improvements 10.72.0203 RU3
27	LCOS improvements 10.72.0092 SU2
27	LCOS improvements 10.72.0091 RU1
30	LCOS improvements 10.72.0015 Rel

31 **7. General advice**

31	Disclaimer
31	Backing up the current configuration
31	Using converter firmwares to free up memory

## 1. Preface

The LANCOM family of operating systems—LCOS, LCOS SX, LCOS LX, and LCOS FX—forms the trusted basis for the entire LANCOM range of products. Within the scope of the hardware specified by the products, the latest firmware version is available for all LANCOM products and is offered by LANCOM Systems for download free of charge.

This document describes the innovations within LCOS software release 10.72 RU14, as well as the improvements since the previous version.

**Before upgrading the firmware, please pay close attention to chapter 7 “General advice” of this document.**

**Latest support notes and known issues** regarding the current LCOS version can be found in the support area of our website

[www.lancom-systems.com/service-support/instant-help/common-support-tips](http://www.lancom-systems.com/service-support/instant-help/common-support-tips)

## 2. The release tag in the software name

### **Release Candidate (RC)**

A Release Candidate has been extensively tested by LANCOM and includes new LCOS features. It is suitable for testing and is not recommended for use in productive environments.

### **Release Version (REL)**

The release version has been extensively and successfully tested in practice. It contains new features and improvements over previous LANCOM operating system versions and is therefore recommended for use in productive environments.

### **Release Update (RU)**

A release update is a further development of an initial release version in productive environments and contains minor improvements, security fixes, bug fixes and smaller features.

### **Security Update (SU)**

Contains important security fixes for the respective LANCOM operating system version and ensures that your security level remains very high on an ongoing basis in your productive environment.

### 3. Device-specific compatibility to LCOS 10.72

LANCOM products regularly receive major firmware releases throughout their lifetime which provide new features and bugfixes.

LCOS release updates including bugfixes and general improvements are available on a regular basis for devices which do not support the latest LCOS version. You can find an overview of the latest supported LCOS version for your device under [www.lancom-systems.com/products/firmware/lifecycle-management/product-tables](http://www.lancom-systems.com/products/firmware/lifecycle-management/product-tables)

#### **Support for the following devices is no longer available as from LCOS 10.72:**

- LANCOM 1781EF+
- LANCOM 1783VA
- LANCOM 1781VAW
- LANCOM 1783VA-4G
- LANCOM R883VAW
- Business LAN R800A

### 4. Advices regarding LCOS 10.72

#### **Information on default settings**

Devices delivered with LCOS 10.00 or higher automatically connect to the LANCOM Management Cloud (LMC). This functionality provides zero-touch installation for new devices. In case you do not want to use the LMC, this feature can be disabled while running the default setup wizard for the initial configuration, or at any time from within LANconfig under Management > LMC. You can manually re-enable the usage of the LMC whenever you want.

#### **Omission of VPN rules in the IPv4 firewall**

As of LCOS 10.70, VPN rules for generating network relationships (SAs) are no longer supported in the IPv4 firewall and are replaced by the 'Network rules' configuration option in the VPN menu.

This mainly concerns scenarios with IKEv1 connections.

For more details see:

<https://support.lancom-systems.com/knowledge/pages/viewpage.action?pageId=85885727>

## 5. Feature overview LCOS 10.72

### 5.1 Feature highlights 10.72

#### **Advanced Mesh VPN**

With classic, star-shaped VPN site networks, in which all branches are only connected via the headquarters and not directly to each other, the Internet line of the headquarters quickly becomes the bottleneck of the entire communication. With Advanced Mesh VPN, the branch offices are now directly interconnected, resulting in significantly less traffic at the headquarters and thus higher performance. The VPN tunnels are established dynamically as soon as data traffic is transported from one branch office to another. If there is no more communication, the VPN connection is terminated dynamically as well

### 5.2 Further features 10.72

#### **Protection of minors according to official regulations**

With LCOS 10.70 RC1, you can now maximize the protection of underage end users, e.g. in schools or youth facilities. For example, the official website list of the “Bundesprüfstelle für jugendgefährdende Medien” (German Federal Review Board, BPjM) is now also part of the LANCOM Content Filter Option or available separately via the software extension LANCOM BPjM Filter Option (as of LCOS 10.70 Rel). This means that domains whose content is officially classified as harmful are not accessible to the relevant target group in Germany. Continuous updates and extensions of this list are guaranteed.

#### **Two-factor authentication – double security for your VPN**

Whenever a high level of security for your sensitive data is required or, for example, compliance guidelines in your company demand it, double protection of network access via your LANCOM Advanced VPN Client is ideal. Thanks to two-factor authentication (IKEv2 EAP-OTP), you can now protect VPN access and thus also your network from unauthorized access. You can specify that users can only log in via the LANCOM Advanced VPN Client if they use two-factor authentication when logging in. In this case, the VPN password is supplemented by a time-based one-time password, which can be generated in an authentication app (e.g. Google Authenticator) on the cell phone. This feature can be used with all devices that have at least 25 VPN tunnels (either already integrated or upgraded with LANCOM VPN Option).

**You can find further features within the individual builds sections in chapter 6 “History LCOS 10.72”.**

## 6. History LCOS 10.72

### LCOS improvements 10.72.0982 RU14

#### Bug fixes / improvements

##### General

- OpenSSL uses Certificate Signing Requests (CSR) in version 1. However, the version was not verified, so requests with different versions were also accepted. After updating to OpenSSL 3.5 in LCOS 10.94, the CSR version is checked, and requests with different versions are rejected. Access points and Wi-Fi routers send CSRs in version 3 to the Wi-Fi controller up to and including LCOS 10.92. This resulted in newly added access points and Wi-Fi routers running LCOS versions up to and including 10.92 being unable to obtain a certificate from a Wi-Fi controller running LCOS 10.94 and, consequently, being unable to be managed by it (already connected access points and Wi-Fi routers were not affected).
- If an SSH session or a CLI tunnel to a router (jump host) was started and an SSH session to another router was initiated from that router, transferring large amounts of data could result in the SSH client's received packets not being read on the jump host. This caused the SSH session to 'freeze', and no further data could be transferred.  
If the jump host remained in this state without the session being manually terminated, this led to an unexpected reboot of the router.
- OpenSSL has been updated to version 1.1.1zg. \*

\* LANCOM Systems keeps all program libraries used in LCOS firmware up to date with the latest security patches and fixes security vulnerabilities even if they cannot be exploited in the firmware.

## LCOS improvements 10.72.0979 RU13

### Bug fixes / improvements

#### General

- When the maximum size of the RADIUS user table was reached, the Public Spot wizard returned an invalid page without an HTTP header instead of a meaningful error message when creating a new Public Spot user. The message "The Server provided an invalid message! Content Length: 0" was displayed in the web browser.
- When multiple service objects and a DNS target were used simultaneously in a firewall rule, the DNS target was not taken into account.
- The status of the 'Remote Tables Last Change' info field in the 'Status/LLDP' console path was not processed correctly if it was empty (zero). When reading the 'Status/LLDP' console path, this caused the CPU load to permanently increase to 100%.
- If an IDS/DoS message was sent by the firewall after an IDS/DoS event, this could cause the router to restart unexpectedly.
- Due to a change in the file name format, updates for the BPJM filter could be downloaded but not unzipped. The message "Info-Request-failed" was then displayed in the console path 'Status/Firewall/BPJM/Last-update-result'. This resulted in the BPJM filter not being functional.
- The zLib library has been updated to version 1.3.2. \*
- The OpenSSL library has been updated to version 1.1.1zf. \*

\* LANCOM Systems keeps all program libraries used in LCOS firmware up to date with the latest security patches and fixes security vulnerabilities even if they cannot be exploited in the firmware.



## LCOS improvements 10.72.0974 RU12

### Bug fixes / improvements

#### General

- On a vRouter operated in Hyper-V, the checksums for TCP and UDP were calculated incorrectly for a PPPoE connection. Depending on the network card used, this could lead to heavy packet loss, among other things.
- If a timeout occurred when using the internal HTTP server (e.g. to provide certificates) via a slow connection, this led to an immediate restart of the router.
- If an action with a large number of characters was stored in a firewall rule via WEBconfig, this led to an immediate restart of the router.
- The 'jsPDF' program library has been updated to version 3.0.2, which fixes the security vulnerability described in CVE-2025-57810.
- When downloading the signature updates for the BPJM filter, the comparison of the local file header with the central directory record of the zip file with the signature update failed. This resulted in the signature update not being able to be downloaded. The error message "Zip extraction failed" was displayed in LANmonitor.

#### VPN

- A newly created IKEv2 connection under iOS 26 could not be established because a new iOS feature was not compatible with LCOS.
- After a failed connection attempt by a device with configured IKEv2-EAP to a router without configured IKEv2-EAP, the established security association (SA) remained in the router's security association database (SADB) and was no longer deleted.

#### Wi-Fi

- If a 4-digit VLAN ID was entered in the 'Set up WLC profile' setup wizard, this could cause the device to restart immediately after completing the wizard.

## LCOS improvements 10.72.0890 RU11

### Bug fixes / improvements

#### General

- It could happen with the following routers that the TCP checksums were calculated incorrectly. This led to timeouts of TCP sessions that were initiated by the router and transmitted via VPN.
  - 1800EF
  - 1800EFW
  - 1800EF-4G
  - 1800EF-5G
- When calling the actions 'Delete-History' and 'Retrain' via WEBconfig (menu path 'Extras / LCOS menu tree / Status / xDSL / xDSLx'), the submenu for executing the commands was not loaded and the error message "Not Found" was displayed instead.
- If IPv6 was active on a router, the router could restart immediately when Netflow analyzed an FTP data session that was transmitted via IPv6.
- In the OSPF route redistribution with configured metric source 'Protocol' it could happen that routes of type LSA 5 were not propagated.
- After a failure of the mobile network infrastructure of a mobile network provider, the used APN may be placed on a blacklist. However, on routers with Sierra MC7421, EM7421, and MC7455 cellular modems, the assigned timer for the entry in the blacklist was not interpreted correctly, so that the timer sometimes did not expire or expired very late. As a result, it was not possible to dial in to the mobile phone provider during the blocking state.
- After a hardware reset of an R883+ or R903 managed by the LMC, the LMC certificate was not deleted.
- If there were more than 32 entries in the port forwarding table, this led to an immediate restart of the device when writing the configuration via LANconfig.
- A plain Ethernet remote station with a dynamically generated MAC address ('MAC address type' set to 'Local') of a vRouter operated in Hyper-V was not established, so that the Internet connection could not be established. Furthermore, in such a scenario, several plain Ethernet remote stations with dynamic MAC addresses created in the vRouter could not exchange ICMP packets (ping) with each other.

- After the maximum number of half-open connections for a connection source or connection destination was reached, the DoS (Denial of Service) detection dropped these packets until the runtime of all half-open connections for this source or destination expired and they were deleted. This could lead to desired data traffic also being discarded.  
DoS detection now allows communication after the maximum number of half-open connections has been exceeded, when the threshold has fallen below half again.
- In the configuration of a RADIUS server, it was not possible to use an existing backup server in a profile. After saving the profile, the selection was no longer available.
- Up to and including LCOS 10.80, it is possible to assign two xDSL interfaces to an Internet remote station on routers of the 1900 series with two xDSL modems. The Internet connection is then established via the xDSL modem for which the DSL sync has taken place.
- OpenSSL has been updated to version 1.1.1zb, which fixes some security vulnerabilities (CVE-2024-13176, CVE-2024-9143).
- By updating the zLIB library to version 1.3.1, a security vulnerability has been fixed (CVE-2016-9840).
- If ICMP line polling was configured with an incorrect sender address for Internet and VPN connections (e.g. due to a typing error), there was no output in the line polling trace.

### **VPN**

- If DNS addresses were specified as IPv4/IPv6 target addresses instead of IP addresses in a VPN load balancer configuration, the table in the path 'Status/VPN/Load-Balancer/Peer-Status/' was filled with an infinite number of entries.
- In individual cases, when setting up / rekeying a Child\_SA (ESP SA) on a LANCOM ISG-4000 / ISG-5000 / ISG-8000 and the vRouter, it could happen that a non-functional Child\_SA was created. As a result, no data could be transferred via the VPN tunnel.



**Wi-Fi**

- In the RADIUS table of a LANCOM WLC-60, only a maximum of 128 entries could be created for Public Spot users. A maximum of 256 entries are now possible.
- The mechanism for cleaning up the Wi-Fi ARP table did not work correctly, which could result in multiple entries for wireless clients. As a result, ARP packets for these wireless clients were not forwarded and communication was severely restricted.
- The IAPP table can hold a maximum of 2048 entries. New access points can therefore no longer be added once the maximum has been reached. If an access point could no longer be added to the IAPP table and therefore could not be found in the table, this led to an immediate restart of the access point.

**VoIP**

- SIP-ALG set the media endpoint for outgoing INVITEs in RTP to 0.0.0.0. As a result, no RTP session could be established and no voice transmission was possible.

## LCOS improvements 10.72.0771 SU10

### Bug fixes / improvements

#### General

→ A security vulnerability in the web interface has been fixed, which allowed unauthenticated attackers to cause an unexpected device restart (DoS attack) by sending a manipulated packet. This affected administrative access via WEBconfig from the LAN and the WAN (if management access via HTTP/HTTPS from the WAN was enabled), as well as the web services IPsec-over-HTTPS, SCEP, OCSP server/responder, and the Public Spot. In the default configuration, access to the router from the WAN is disabled, meaning the router was not affected by this vulnerability in such cases. The TR-069 protocol was also not affected by the vulnerability.

## LCOS improvements 10.72.0770 RU9

### Bug fixes / improvements

#### General

- In individual cases, it could happen that configured BGP neighbours were created twice. The first connection remained permanently in the 'Established' status. However, the router repeatedly tried to establish the second connection, which led to a collision with the existing connection and thus to the connection being terminated. This was acknowledged by the error message "Connection collision resolution".
- Occasionally, routers with multi-core CPUs could cause the scheduler not to assign any work to the TCP job. As a result, SSH connections to the affected router were very slow and routers managed by the LMC repeatedly lost the connection to the LMC.
- When using LACP and VRRP at the same time, the VRRP multicast packets were not transmitted via the LACP bundle. As a result, communication between the VRRP routers was not possible and flapping occurred.
- If a BGP neighbor with a fixed WAN interface was configured as the sender address, it could happen that BGP selected the wrong sender address if the configured interface was not yet active. No BGP connection could be established in the next step with the incorrect sender address. This particularly affected interfaces with DHCP client.

#### WLAN

- In scenarios where 802.1X authentication was used for SSIDs, clients with Windows 11 operating system could not connect to the SSID because authentication failed.

#### VoIP

- In a SIP connection to a WebEx server in which a WebEx subscriber had configured call forwarding, the encrypted voice transmission (SRTP) failed when rekeying was triggered by the other party. As a result, a one-way voice transmission took place.
- With a received "200 OK", the session parameter 'refresher' was only considered 'case sensitive' (here: in lower case). As a result, longer calls with voice-over-WLAN could not be properly refreshed and aborted.

- If the voice call manager received the message “403 Forbidden” on its REGISTER from the SIP provider, the voice call manager continued to try to register. This could lead to the registration being temporarily blocked by the SIP provider.  
In such a case, the voice call manager now sends a REGISTER after 15 seconds. If this is also acknowledged with the message “403 Forbidden”, the voice call manager only sends the next REGISTER after a randomly determined period of 30 to 60 minutes (1TR114 Annex B).
- In scenarios where the same SIP server was used for registration via UDP, TCP and TLS, the voice call manager prioritized the NAPTR records incorrectly if the DNS responses received were in a different order than the DNS responses sent.
- In the event of a failure of all TCP SIP servers that were resolved via NAPTR, the voice call manager sent several new TCP SYN packets per second to all servers. If all UDP SIP servers that were resolved via NAPTR failed, the voice call manager sent too many new REGISTER packets in a defined period of time. In the event of unavailability, a failed request is now repeated at regular intervals with increasing delays between requests by means of an exponential backoff.

## LCOS improvements 10.72.0696 RU8

### Bug fixes / improvements

#### General

- The use of more than one plugged-in SFP module of the type 'SFP-CO10MG' could lead to an immediate reboot of the LANCOM router.
- When using Mesh VPN, it could happen in individual cases that several processes were working on the same variables at the same time. This led to an immediate restart of the router.
- If no SSL certificate is available for access via the web interface, LCOS can generate a temporary certificate from the 'ssl\_privkey'. If an ECDSA key instead of an RSA key was stored in the 'ssl\_privkey', no temporary certificate could be generated. As a result, access via WEBconfig was not possible and the web browser used acknowledged the process with an error message due to an incorrect certificate.

#### VPN

- If more than 1000 VPN connections were established simultaneously, the 'VPN-IKE' process occupied all free CPU resources and the CPU load of the router increased to 100 %. As a result, the establishment of VPN connections stopped and some connections were terminated again due to a DPD timeout. As a result, a large number of VPN connections could not be established.

#### Wi-Fi

- With a LANCOM ISG-5000 managed via LMC, a maximum of 128 Public Spot users could be created.
- A background image uploaded to the public spot was cut off at a size of 1500 x 999 pixels on the displaying device because the associated variable only had a length of 16 bits.
- In a Public Spot scenario, when using self-created welcome pages and using the authentication method 'Login after declaration of consent', an error message could appear during the first login to the system, claiming a missing e-mail address.

#### VoIP

- If the Voice Call Manager received an error message in the SIP that belonged to a SIP call that no longer existed, this led to an immediate restart of the router.
- In the WEBconfig configuration dialog for adding a new DECT handset, the field for assigning the handset ID was missing.

## LCOS improvements 10.72.0593 RU7

### Bug fixes / improvements

#### General

- In a scenario with DPS (Dynamic Path Selection), switching the session to a better line (passive switchover for DPS) for UDP packets did not work on central devices.
- A security vulnerability in the SSH protocol has been fixed ('Terrapin' security vulnerability/CVE-2023-48795).
- On 5G routers with an IPv6-only mobile connection, an IPv4 context is set up in addition to the IPv6 context. The IPv4 context reports a 'link down' after two minutes due to inactivity. This incorrectly led to the entire mobile connection being terminated.
- In a scenario with config sync, it could happen that no synchronization of the configurations was carried out due to a failed TLS handshake.
- In a VRRP scenario in which ICMP line polling was used for a remote station, it could happen that a switch back from the backup device to the master device failed.
- After disconnecting from the Internet, it could happen that the MAC address of the router was used instead of the stored user-defined MAC address.
- The 'Layer 7 application detection' could not resolve packets with QUIC, as a result of which the corresponding data traffic was not listed in the statistics.
- When using the Safari browser under iOS / macOS, the configuration could not be saved via WEBconfig.
- If there were a large number of routing entries on a router (e.g. learned via BGP) and all interfaces were read out by a monitoring tool via SNMP (SNMP path 1.3.6.1.2.1.4.24.4, RFC 2096), the router's CPU was fully utilized. The router was then restarted immediately.
- If the 'Address Family Transition Router' (AFTR) of the provider was changed for a Dual Stack Lite connection, it could happen that the new DNS address of the AFTR could not be reached because the DNS address of the previous AFTR was still being used due to a problem with the DNS cache.
- In the case of very extensive configurations in conjunction with a large number of accesses to the device in quick succession (e.g. via WEBconfig), it could happen in individual cases when writing the configuration via LANconfig that the device assumed that no main device password had been set.

- If an Internet provider does not send a 'Router Advertisement' when obtaining the IPv6 parameters via PPP, the router then sends a request via DHCPv6 with IA\_NA and IA\_PD. If the DHCPv6 Advertise message from the provider did not contain an IA\_NA or the message "NoAddrAvailable" was issued instead, the router was unable to obtain an IPv6 prefix and communication was not possible.  
In such a case, the router now sends a new 'Solicit' to the provider, which only contains IA\_PD.

### **VPN**

- The ICMP polling function used an incorrect routing tag during the polling process, which could cause the connection setup to fail for IKEv2 connections for which a routing tag was specified in the routing table.
- In individual cases, the router could restart unexpectedly if a large number of VPN operations were carried out in quick succession.

### **VoIP**

- If the encryption function was activated in the settings of a SIP line, an IPv6 registration with the registrar forced in the 'SIP domain/realm' field with the suffix '?6' did not work.
- If the Voice Call Manager routed an incoming call to an internal user with multiple registrations (SIP user with multiple SIP registrations or ISDN user with activated parallel call), who forwarded the call to another subscriber, the Voice Call Manager did not send a source phone number. As a result, the phone number of the original caller was not sent to the other subscriber.
- The Voice Call Manager does not support RTP extensions. If the Voice Call Manager received an incoming call with RTP extensions, it also sent the RTP extensions in the 'SDP Answer'. This meant that the called party could not hear the caller.  
The Voice Call Manager no longer sends RTP extensions in the 'SDP Answer'.
- If a SIP user had registered on the LANCOM router without transport parameters, an INVITE was rejected due to the missing parameter and a call could not be established.

## LCOS improvements 10.72.0484 RU6

### Bug fixes / improvements

#### General

- If the remote destination (such as an access point) confirmed several packets with an ACK during an L2TP tunnel to a router, this meant that the sessions on the router were not deleted after the connection was closed. As a result, the L2TP connections could not be re-established.
- Using WEBconfig, a maximum value of 2147483647 could be entered in the 'Remote AS' field in the 'Configuration / Routing protocols / BGP / Neighbors' menu, although higher values were also possible via the console and LANconfig.
- A faulty BGP base attribute could cause the BGP connection to be terminated (VU#347067).
- If several ARF networks were configured on a router with the same IP address (separated by VLAN), a configuration change in the ARF networks triggered 'gratuitous ARP flooding' in each network. In scenarios with a large number of identical ARF networks, this could lead to severe packet loss and also to an immediate restart of the router.  
After changing the configuration of the ARF networks, only one 'gratuitous ARP' is now sent for each network.
- The IDS blocked the keepalive packets of a GRE tunnel because the firewall expected at least 2 bytes of user data in GRE packets after the protocol field. As a result, the GRE tunnel was repeatedly taken down.
- If so much data was transferred via a PPTP connection that the transfer queue was full even though the 'flow control' was already discarding packets, this led to an immediate restart of the router.
- A GPON module that had already been used in a LANCOM router and successfully connected to a Deutsche Telekom Internet connection no longer worked in another LANCOM router, although it was already known through the initial use of OLT (Optical Line Termination).
- If there were a large number of routing entries on a router (e.g. learned via BGP) and all interfaces were read out by a monitoring tool via SNMP (SNMP path 1.3.6.1.2.1.4.24.4, RFC 2096), the router's CPU was fully utilized. The router was then restarted immediately.

**VPN**

→ If the router received an 'Informational-Request' with a DELETE(CHILD\_SA) message followed by a DELETE(IKE\_SA) message when an IKEv2 connection was established, this led to an immediate restart of the router.

**Wi-Fi**

→ The source VLAN check (Setup / Public Spot modules / Check-Origin-VLAN) in the Public Spot only worked for VLANs that were assigned via RADIUS. If the VLAN assignment was made using a different method (e.g. via circuit ID), the WLAN client was not logged out of the Public Spot and was able to communicate in other existing Public Spot SSIDs.

**VoIP**

- If the Voice Call Manager received a duplicate 'Connection Information' with different IP addresses during an incoming call in a dialog ('180 Ringing', '183 Session Progress' or '200 OK'), it could happen that the Voice Call Manager sent the answer to the wrong IP address. This led to a one-sided voice transmission.
- After changing the SIP server, the IP address of the old server remained in the cache instead of being deleted. As a result, the entry for the old SIP server continued to have the highest priority, so that no change to the new SIP server took place. If the old SIP server was no longer functional or refused registration, this meant that telephony was no longer possible.
- When a call was forwarded from an ISDN PBX to a SIP subscriber, one-sided voice transmission could occur sporadically due to incorrect transcoding.

## LCOS improvements 10.72.0385 RU5

### Bug fixes / improvements

#### General

- On a LANCOM 1793VA-4G, the SIM card remained offline when the router was without power or a cold boot was performed via the command line.
- A newly added 'Virtual Link' was not automatically detected with OSPF enabled. OSPF had to be globally deactivated and reactivated for this.
- Running a script with the 'beginscript' & 'exit' commands sporadically caused existing BGP connections to be disconnected.
- After an undefined time (possibly several weeks), the WWAN module switched itself off and was then in 'Disabled' status. As a result, an Internet connection was disconnected.
- With cellular routers, it could happen that an error was displayed in the connection information of the cellular connection (Status/Modem-Mobile/Connect-Info), although the connection was established.
- If a SFP-GPON-1 module with activated 'Dying Gasp' function was plugged into the LANCOM router, no automatic configuration change with subsequent restart of the module took place. As a result, the PON management connection did not start and remained in the 'Opening management connection' state.
- On some LANCOM routers the OID 1.2.20.10 was missing in the configuration (path 'Setup/LAN-Bridge/Protocol-Table' in the CLI / menu 'Interfaces / LAN / LAN-Bridge / Protocols' in LANconfig & LMC).
- LANCOM cellular routers could fail to re-initialize the USB module, resulting in an immediate reboot of the router.
- If an incorrect APN was entered on a mobile router with a 5G module, this led to an immediate reboot of the router after a few minutes.
- In individual cases, an 802.1X authentication of users with the 'Framed-IP-Address' attribute could result in an immediate restart of the router.
- If several hundred or thousand messages were sent in the DNS in a short time, it could happen that this occupied more memory than was originally reserved for it. This led to an immediate restart of the router.
- When using the 802.1X authenticator on a LAN port, the router learned the MAC address of a connected device even though it was not authenticated. This allowed communication with the connected device.  
MAC addresses are now no longer learned automatically when using the 802.1X authenticator, thus preventing communication.

→ The TR-069 service sent its requests with the IP address instead of the DNS name of the ACS server. This caused the TLS connection to be terminated on a strictly configured ACS server with SNI because the URI and the name in the certificate did not match.

#### **VPN**

→ If a LANCOM router received an 'INVALID\_SPI notification' from another router, the LANCOM router deleted the child SA of the associated IKEv2 connection. It could happen that the memory of the deleted child SA was occupied twice. This led to an immediate reboot of the router.

#### **WLAN**

→ In a 'Config Sync' scenario, the slave WLC restarted abruptly when four or more entries were written to a status table about errors in the configuration.

→ If a LANCOM access point was managed via LMC and there was an SSID with 802.1X (RADIUS) authentication to a RADIUS server with a name longer than 15 characters, it could happen that an incorrect RADIUS server was addressed. The reason for this was that there was no check in the LMC for the length of the RADIUS profile name and the LCOS only used names with a maximum of 15 characters.

#### **VoIP**

→ When DNS resolving SRV records via NAPTR, the output of the console command 'show vcm dns' always showed one SRV record more than was actually resolved.

→ In a SIP trunk scenario with gateway line to a SIP PBX, if the router received a 'RE-INVITE' from the SIP provider on the SIP trunk with 'refresher' in the 'Session-Expires' header (in this case 'refresher=uas'), the Voice Call Manager changed the 'refresher' in the "200 OK" to the SIP provider (to 'refresher=uac'), which is not allowed. This caused the call to be disconnected by the SIP provider.



## LCOS improvements 10.72.0291 RU4

### Bug fixes / improvements

#### General

- After activating a VPN-25 option on a router (no reboot required), the device certificate could not be downloaded in WEBconfig via the 'Download current CA certificate' option when the CA was activated. The process was acknowledged with the error message 'Not Found'. The download of the certificate was only possible after a restart.
- On a serial device connection, an active session was not disconnected when using the 'passwd -n' command in a script.
- The value specification for memory usage was incorrectly output on the display page for LANCOM devices with LCOS.
- After a change of the LMC parameters by the LMC (Setup/LMC), the previous HTTPS session was still used. If the parameters were incorrect, this meant that the device could no longer reach the LMC after a restart.  
The HTTPS session is now rebuilt after the LMC parameters are changed. If the device can no longer reach the LMC with the changed parameters, a rollback to the previous parameters takes place.
- Usually, Internet providers distribute the parameters of an IPv6 connection by initially sending a router advertisement. If an Internet provider instead initially sent the IPv6 parameters via DHCPv6 and only after a longer time sent a router advertisement with the gateway, the gateway was not displayed in the 'Status/WAN/IP-Addresses/IPv6' table.  
After a change of the gateway, this is now taken over into the table.
- When calling an SNMP path in the MIB-2, the information about the SFP port was read out twice in routers of the 1900 series and the memory was not released again. This meant that if the SNMP path was read out repeatedly over a longer period of time, no more free memory was available. This led to an immediate restart of the router.
- If more than one MAC address was detected on a port when using the '802.1X Authenticator for ETH ports', this caused the port to be shut down and thus no more communication was possible via this port.

- In the console path 'Setup/LAN/IEEE802.1X/Authenticator-Ifc-Setup' there is now the option 'Single-Host-Violation-Block'. If this is set to 'No', only the first authenticated device can communicate via the port. Traffic from other connected devices is then blocked.  
If the command 'Default' was executed in the console path 'Setup/COM-Ports/WAN/Devices' on a 1900 series router with 5G module, the table was subsequently empty. This implicitly set the 'Operating' mode to 'No' for the 5G module, so the 5G module was disabled.  
If a device is not present in the 'Setup/COM-Ports/WAN/Devices' table, the 'Operating' mode is now set to 'Yes'.
- If a LANCOM router received an idle time window for a firmware update from the Auto Configuration Server (ACS) via TR-069 ('when idle' mode), the update was not performed after the idle time window ended.
- If telephony was also configured via TR-069 when the configuration was obtained from an Auto Configuration Server (ACS) of Telekom, the router always entered the URL 'tel.t-online.de' for the registrar, even if this was not transmitted by the ACS.
- EAPoL frames can now be transmitted via multicast if the corresponding option is enabled in the menu 'Setup/LAN/IEEE802.1x/Authenticator/IFC-Setup'. In multi-host mode, this allows identity requests for RADIUS authentication of a LANCOM access point to be sent via multicast instead of unicast.
- In the configuration of a LANCOM router it was possible to use a logical WAN interface (e.g. DSL-1) for several physical interfaces (e.g. SFP port and ETH port). In this case, problems could occur with (PPPoE) dial-up to WAN connections.

### Wi-Fi

- UDP traffic could also be transmitted without logging into the Public Spot, allowing some applications to communicate with their servers on the Internet.

### VoIP

- Since the LANCOM router did not support the 'UNENCRYPTED\_SRTCP' parameter, calls were terminated by the provider after a few seconds because the unencrypted RTCP packets from the SIP client could not be passed through to the SIP provider.
- If the LANCOM router was used as a session border controller (SBC) with an upstream PBX on a CompanyFlex connection, the DTMF in-band transmission did not work on an encrypted connection.

## LCOS improvements 10.72.0203 RU3

### Bug fixes / improvements

#### General

- When forwarding to an external RADIUS server, the specified IP address was entered in reverse order in the configuration on a LANCOM 1800EFW.
- If the feature activation is initiated via console and the license server is not accessible, the activation remains in the 'processing' state. If the feature activation was subsequently initiated again via console, this led to an immediate reboot of the device.
- When an OSPF configuration was saved and route redistribution was added in a second step, the LANCOM router did not announce itself as an ASBR (Autonomous System Boundary Router).
- OSPF interface costs were presented with incorrect values due to incorrect internal processing.
- The data volume budget counter did not take into account data transmitted over IPSec connections.
- Due to a problem with the initialization of the WWAN module, it could happen that an existing WWAN connection was no longer established on LANCOM cellular routers after a firmware update.
- In the WEBconfig dashboard, the HTTPS port was displayed with '1' instead of '443' in the services overview for web services.
- If in the OSPF configuration of a LANCOM router the value 'Advertise-Default-Route' was set to 'Dynamic', announcing the default route did not work, although the route was present in the FIB.
- The DHCPv6 client ID was specified with the value '0' instead of the respective MAC address for WWAN interfaces.
- If a RADIUS server was used for authentication on a LANCOM router and this authentication did not work, the fallback to local authentication failed (login stopped) and the router performed an unmediated reboot after a few minutes.
- If the SIM card was changed on a mobile router with a 5G module during operation, this led to an unmediated restart.
- If no DNS server was stored when DNS forwarding was activated, the router did not report this to the requesting network subscriber.  
In such a case, the router now sends the "server failure" message to the requesting network node.

→ If port forwarding is also to be possible for the connection with the higher value (backup connection) when using the 'Administrative distance' function, another routing entry must be created for this (dummy route). This dummy route was not taken into account during port forwarding, so packets could not be forwarded via the backup connection.

### **VPN**

- If an IKEv2 VPN connection was configured to AES-GCM, incoming fragmented ESP packets were dropped with an error message.
- In individual cases, it could happen that the 'Security Associations' of a VPN connection were not terminated when switching to a backup connection. As a result, the VPN connection could no longer be established. In such a case, the message "VPN: local reconnect lock active" was displayed in a VPN status trace.
- When using an IKEv2 connection via RAS Config Mode between two LANCOM routers with activated IPv4 routing, the stored networks were transmitted twice. In this case, a VPN status trace displayed the message "IKEv2 routes have already been exchanged". This resulted in errors on the VPN connection.

### **Wi-Fi**

- A managed access point did not use the VLAN ID entered in the SSID in the WLAN controller, but always the VLAN ID available in its local configuration in the group key index. This meant that broadcasts and multicasts could not be decrypted and thus could not be transmitted.

### **VoIP**

- If, after resolving the 'SRV Resource Record', the Voice Call Manager determined that it was not connected to the SIP server with the highest priority, it initiated a switch to the highest priority server. To do this, the Voice Call Manager sent an Un-Register to the previous SIP server to disconnect it. If the unregister was not answered by the previous SIP server, the Voice Call Manager did not switch to the correct SIP server.
- If the router received a Re-INVITE from the SIP provider with SDP parameters that the Voice Call Manager could not process, it sent the message "500 Server Internal Error" instead of the message "488 Not Acceptable Here". This caused the SIP provider to terminate the call.  
If the primary SIP server fails, a switch to a SIP server with low priority takes place. In this case, a switch back to the primary SIP server should only occur after 15 minutes.

Until now, the Voice Call Manager checked at each SRV resolution whether the SIP server with the highest priority was used and initiated a switch if necessary.

Furthermore, it could happen that the check of the used SIP server was already performed during the initialization if the IP addresses of the SIP servers were not yet transmitted.

→ If a SIP phone registered on the router performed call forwarding for an incoming call and directly sent a REFER followed by a re-INVITE instead of parking the call (hold), this resulted in two INVITE packets being sent by the SIP phone for the same call ID. The phone call was then disconnected by the provider, so that call forwarding was not possible.

In such a case, the Voice Call Manager now waives authentication for the re-INVITE of the SIP phone and sends this directly to the forwarding destination. The "SIP 200 OK" from the forwarding destination is then forwarded to the SIP phone, so that the double INVITE is avoided.

→ If in a scenario with an ISDN PBX a call forwarding via FACILITY message and call re-routing was successful, the source number was not taken over if the Voice Call Manager did not use SIP302 or the SIP provider did not support SIP302.

→ For an incoming call to an analog or ISDN phone, the Voice Call Manager only considered the original SDP Offer instead of the SDP Answer when selecting the codec for the RTP traffic. This could result in an incorrect codec being selected. In such a case, no voice transmission was possible and the call was terminated after a short time.

The Voice Call Manager now always uses the PCMA codec if it is offered in the SDP Offer.

→ If an outgoing telephone call was initiated by digit dialing in a scenario with an ISDN PBX, the telephone number was not transmitted completely if the individual digits were transmitted too slowly by the ISDN PBX. As a result, the telephone call could not be established.

The Voice Call Manager now uses a 'Short Overlap Timer' of 500 instead of 250 ms.

## LCOS improvements 10.72.0092 SU2

### Bug fixes / improvements

#### General

- Security improvements due to an update of the OpenSSL version to 1.1.1t (CVE-2023-0286, CVE-2022-4304, CVE-2023-0215 and CVE-2022-4450).

## LCOS improvements 10.72.0091 RU1

### New features

- With the DHCPv6 Relay Agent, up to 4 destinations can now be configured for forwarding to external servers.
- The DHCPv6 Relay Agent supports a sending address towards the DHCPv6 server.
- The BPJM module now has a CLI function to delete the current signature definition.
- „Connection Refused“ messages are now displayed in the syslog with level ‚Info‘ instead of „Alarm“. This means that these messages are no longer displayed in the WEBconfig syslog by default. The behavior can be adjusted by a configuration change.

### Note:

As of the next LCOS major version, the ‚Tx-normal‘, ‚Tx-reliable‘ and ‚Tx-urgent‘ columns of the ‚Status/WAN/Packet-Transport‘ status table are removed and no longer supported. The status table ‚Status/IP-Router/Protocol-Table‘ is also omitted there. The last supported version is LCOS 10.7x.

### Bug fixes / improvements

#### General

- The BPJM feature could be configured even if there was no license for this option.
- The WEBconfig setup wizard for setting up an IPv6 Internet connection wrote the comment field in the ‚Router‘ column of the IPv6 routing table. As a result, the configured IPv6 connection was not functional.

- If data was temporarily not transmitted via Deutsche Telekom's 4G / 5G Internet connection, it could happen that the WWAN Internet network connection was no longer functional after data transmission was resumed.
- As soon as a new configuration was imported into a LANCOM 1900EF-5G via script, the WWAN modem remained in the 'Device Removal/Deactivated' state. The WWAN modem could only be put back into active mode by restarting the device.
- If the password of an encrypted configuration backup contained a '+' character, the encrypted configuration backup could no longer be decrypted and transferred to the LANCOM device.
- With an active backup via WWAN it could happen that after some time the routing between LAN and WAN did not work anymore and could only be restored by disconnecting the WWAN connection.
- If a network subscriber in the router's local network repeats a DNS query too quickly, a second DNS query with the same source port is sent to the backup DNS server. After receiving the response from one of the two DNS servers, the port is closed. If the router subsequently also receives the response from the second DNS server, it is rejected.  
This caused the "connection refused" message to be recorded in the syslog (priority 'Alarm'). This behavior could cause a lot of false positive messages to be recorded in the syslog. The priority of the "connection refused" message has now been changed to 'Info' so that it is not recorded in the syslog in the default configuration.
- In individual cases it could happen that the DHCP server on a router in factory state (setting 'Automatic') did not start and thus could not distribute IP addresses.
- If the router received a broadcast for a certain network on the interface of another network, this led to an immediate reboot of the router if a rule with the received broadcast address as destination was created in the firewall.
- When using ICMP polling for an Internet connection, an unmediated reboot of the router occurred if an ARP request from the polling destination was answered before the Internet connection was established.
- If multiple IP addresses were resolved in a DNS request from the LMC client, the device always used the 'smallest' IP address for communication via TCP instead of performing load balancing across multiple IP addresses. This behavior also affected other applications.  
Now a random IP address is always used.

**VoIP**

- If analog or ISDN devices were connected to the router, the Voice Call Manager always sent the codecs PCMA (G.711-a) and PCMU (G.711-u) in the 'SDP Answer' as soon as one of the two codecs was included in the 'SDP Offer'.
- Now all codecs except PCMA and PCMU are deleted from the 'SDP Offer' and the first codec is taken over into the 'SDP Answer'. If PCMU is used, the Voice Call Manager transcodes this to PCMA, since ISDN and analog devices only support PCMA. If there is no 'SDP Offer' in the INVITE, the Voice Call Manager answers with PCMA and PCMU in the 'SDP Answer'.
- If the option 'Automatic' was selected for 'Signaling encryption' in a SIP line (NAPTR active), it could happen that the re-registration did not work and a new registration had to be performed. As a result, telephony no longer functioned during this period.
- If a router with Voice Call Manager is used upstream of a SIP-TK interface, it acts as a session border controller (SBC). In such a scenario, when an incoming call from a mobile subscriber (VoLTE) was directly transferred via the 'Connect without consultation' (Blind Call Transfer) function, the Voice Call Manager did not negotiate the codec correctly with a specific SIP provider remote station. This resulted in the call being disconnected.
- If a SIP provider used DNS SRV records with the same priority, the Voice Call Manager switched between these servers each time the DNS resolution was repeated. This resulted in a short interruption of the registration.

## LCOS improvements 10.72.0015 Rel

### New features

- Support for Q-in-Q VLAN on WAN interfaces
- Support of a sender address for the update process of the signature file at the BPJM filter
- Master holddown time switch in VRRP
- Support for RADSEC certificates in the SCEP client
- In WEBConfig, there is a link to the Wi-Fi station table in the dashboard under Wi-Fi.
- A LANCOM WLC supports the selection of the LANCOM LX-6500 in the firmware management.
- Support for LANCOM ARC 2.0 together with the LMC

### Bug fixes / improvements

#### General

- Although no Content Filter option was active on a router, the 'Content Filter' menu was displayed in WEBconfig. However, the configuration dialogs were empty.
- In WEBconfig, the configuration settings for the time server adjustment method were missing in the 'Date/Time / Synchronization' menu.
- In the WEBconfig menu 'Setup Wizard / Manage Public Spot Users', users were displayed as 'unauthenticated' although they were successfully connected to the Public Spot.
- In a WWAN connection where the address reference was configured via DHCP, the LANCOM DHCP client sent ARP requests, although these were not required for the WWAN connection.
- The DNS servers stored in the 'IPv4 / Addresses' menu are bound to the LAN interface. If the local IP address of the router was stored as DNS server in this menu and a default route was created which pointed to the IP address of an upstream router in the same IP address range, this led to an immediate restart of the router.

#### Wi-Fi

- If another user was to be added when the RADIUS user table was full, a page with JavaScript code was displayed instead of an error message.
- In LCOS 10.70 it could happen that an incorrect reference to the MAC address of the connected Wi-Fi device was stored in the address table of the WLC tunnel used. As a result, communication via the WLC tunnel no longer worked.

## 7. General advice

### Disclaimer

LANCOM Systems GmbH does not take any guarantee and liability for software not developed, manufactured or distributed by LANCOM Systems GmbH, especially not for shareware and other extraneous software.

### Backing up the current configuration

**Before upgrading your LANCOM devices to a new LCOS version it is essential to backup the configuration data!**

Due to extensive features it is **not possible to downgrade** to a previous firmware without using the backup configuration.

If you want to upgrade devices which are only accessible via router connections or Wi-Fi bridges, please keep in mind to upgrade the remote device first and the local device afterwards. Please see the [LCOS reference manual](#) for instructions on how to upgrade the firmware.

**We strongly recommend updating productive systems in client environment only after internal tests.** Despite intense internal and external quality assurance procedures possibly not all risks can be eliminated by LANCOM Systems.

### Using converter firmwares to free up memory

Due to numerous new functions within the LCOS firmware it may not be possible in some circumstances for older devices to keep two fully-featured firmware versions at the same time in the device. To gain more free memory, a smaller firmware with less functionality has to be uploaded to the device first. As a result, significantly more memory will be available for a second firmware.

This installation has to be done only once by using a “converter firmware”.

After having installed the converter firmware, the firmsafe function of the LANCOM device is only available on a limited scale. The update to a new firmware is furthermore possible without any problems.

However, after a failed update the LANCOM device works with the converter firmware which only allows local device access. Any advanced functionality, particularly the remote administration, is not available as long as the converter firmware is active.